


READ THIS FIRST

If your FusionAmp currently has a firmware version 1.3x or lower, please start with updating your FusionAmp to a v1.4x (like 1.44 or 1.46), before installing v1.51


Due to component availability, we were forced to use different hardware on the DSP3-213 (previously named “MP-DSP-Main”). This resulted also in two versions of firmware 1.x and 5.x

Please choose the correct update file for your device. If HFD startscreen looks like this:

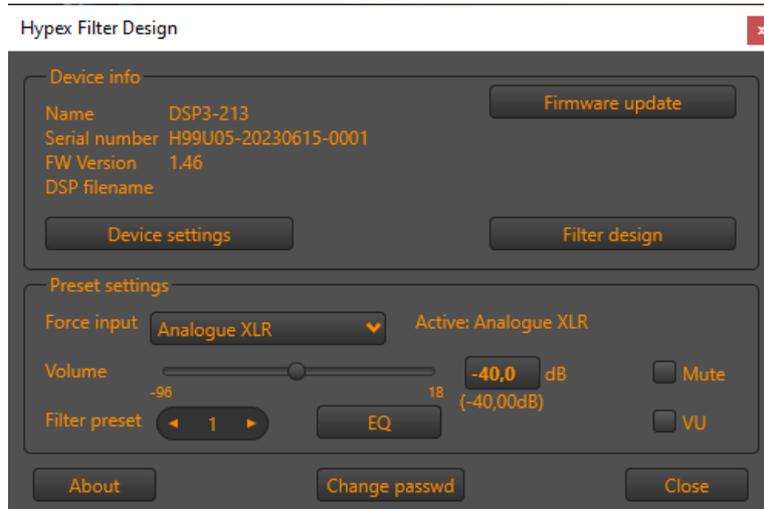

your device has currently firmware version 1.46 and you must use the firmware update v1.xx or 2.xx.

When your device currently has firmware 5.x (like for example 5.3), you must use the update file version 5.xx or higher:

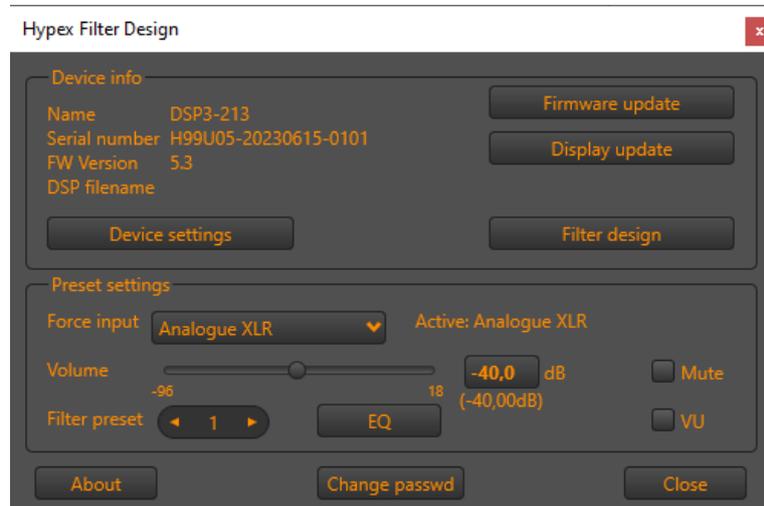

Please notice that only firmware v5.7+ has FIR capability, due to this hardware change.